

1 mm (F) to 1 mm (F) Coaxial Adapter

Description:

Model SCT-1F1F-S1 is a 1 mm female to 1 mm female coaxial adapter that covers the frequency range of DC to 110 GHz. This coaxial adapter offers efficient transitioning between the coaxial connectors with a high return loss and maximum insertion loss of 0.6 dB. The impedance of the



adapter is 50 Ohms. Other configurations are available under different model numbers.

Features:

- Instrumentation Grade
- High Return Loss
- Low Insertion Loss

Applications:

- Test Lab
- Sub-assemblies

Electrical Specifications:

Parameter		Minimum	Typical	Maximum
Frequency		DC		110 GHz
Insertion Loss				0.6 dB
Return Loss	@ DC to 60 GHz			18 dB
	@ 60 to 110 GHz			16 dB
Impedance			50 Ω	
Specification Temperature			+25 °C	
Operating Temperature		-40 °C		+85 °C

Mechanical Specifications:


Item	Specification		
Connector 1 Type	1 mm Female		
Connector 1 Material	Beryllium Copper		
Connector 1 Finish	Gold Plated		
Connector 2 Type	1 mm Female		
Connector 2 Material	Beryllium Copper		
Connector 2 Finish	Gold Plated		
Weight	0.07 Oz (2.1 Grams)		
Length	0.66"		
Outline	CT-1F1F-5		




www.sagemillimeter.com | 3043 Kashiwa Street, Torrance, CA 90505 Phone: 424-757-0168 | Fax: 424-757-0188 | Email: sales@sagemillimeter.com

1 mm (F) to 1 mm (F) Coaxial Adapter



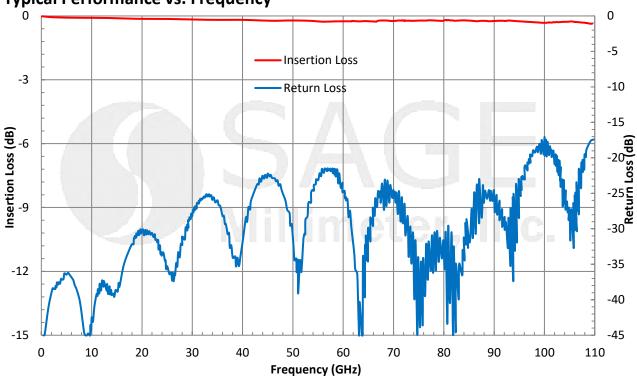

Mechanical Outline: (Unless otherwise specified, all dimensions are in inches [millimeters])

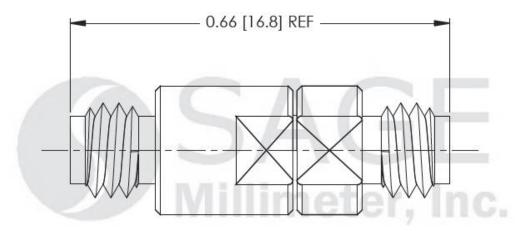

Note:

- All data presented is collected from a sample lot. Actual data may vary unit to unit.
- All testing was performed under +25°C case temperature.
- SAGE Millimeter, Inc. reserves the right to change the information presented without notice.

Caution:

• Proper torque, 4.0 ± 0.15 inch-pounds (0.45 ± 0.02 Nm), should be used. **SAGE Millimeter** torque wrench, model SCH-06004-S1, is highly recommended.



www.sagemillimeter.com | 3043 Kashiwa Street, Torrance, CA 90505 Phone: 424-757-0168 | Fax: 424-757-0188 | Email: sales@sagemillimeter.com