

# Ka Band Waveguide Junction Isolator, 34.5 to 35.5 GHz Band

### **Description:**

**Model SNW-3533630616-28-I8-WP** is a Ka band waveguide junction isolator that covers the frequency range of 34.5 to 35.5 GHz. Compared with a Faraday isolator, the waveguide junction isolator offers a lower insertion loss of 0.5 dB typical and a much shorter insertion length for system integration. As a tradeoff, the waveguide junction isolator only offers a typical isolation of 16 dB. The input and output ports are WR-28 waveguides with UG-599/U flanges.



#### Features:

### **Applications:**

- Low Insertion Loss
- Moderate Isolation
- Compact Configuration

- Port Isolation
- Module Integration

#### **Electrical Specifications:**

Parameter	Minimum	Typical	Maximum
RF Frequency Range	34.5 GHz		35.5 GHz
Insertion Loss		0.5 dB	
Isolation		16 dB	
Return Loss		15 dB	
Forward Power Handling			1 W (CW)
Reverse Power Handling	The same of the sa	0	1 W (CW)
Specification Temperature	_ / \	+25°C	
Operating Temperature	-45°C	Contract of the Contract of th	+85°C

## **Mechanical Specifications:**

Item	Specification	
RF Input and Output	WR-28 Waveguide with UG-599/U Flange	
Body Material	Aluminum	
Finish	Chem Film	
Weight	0.8 Oz	
Insertion Length	0.39"	
Outline	NW-IA2	




www.eravant.com | 501 Amapola Avenue, Torrance, CA 90501 Phone: 424-757-0168 | Fax: 424-757-0188 | Email: support@eravant.com




# Ka Band Waveguide Junction Isolator, 34.5 to 35.5 GHz Band

## Typical Insertion Loss and Isolation vs. Frequency

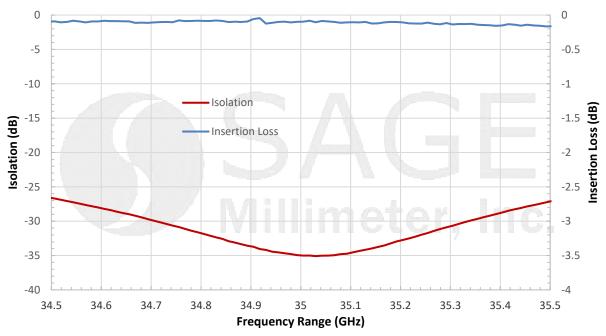

**Mechanical Outline:** (Unless otherwise specified, all dimensions are in inches)

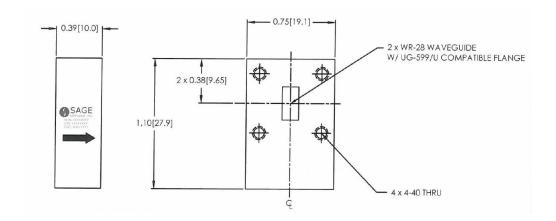

#### Note:

- All data presented is collected from a sample lot. Actual data may vary unit to unit.
- All testing was performed under +25°C case temperature.
- Eravant reserves the right to change the information presented without notice.

#### Caution:

- Exceeding absolute maximum ratings will damage the device.
- This device is magnetic sensitive. Keep the device at least 6" away from magnetic fields.
- Any foreign objects in the waveguide will cause performance degradation and possible device damage.



www.eravant.com | 501 Amapola Avenue, Torrance, CA 90501 Phone: 424-757-0168 | Fax: 424-757-0188 | Email: support@eravant.com